



Mount Thorley Warkworth EPL Monitoring Data

Published 24 September 2019 FOR THE MONTH ENDING 31 August 2019

Name of Operation	Mount Thorley Coal Loader				
Environment Protection Licence	24				
Licensee	Mount Thorley Coal Loading Ltd				
Premises	Mount Thorley Coal Loading Ltd Mount Thorley Road, Mount Thorley				
Tremises	Via Singleton NSW 2330				
	http://app.epa.nsw.gov.au/prpoeoapp/Vi				
EPL Link	ewPOEOLicence.aspx?DOCID=89660&SYS				
	UID=1&LICID=24				
Name of Operation	Mount Thorley Operations				
Environment Protection Licence	1976				
Licensee	Mount Thorley Operations Pty Limited				
	Mount Thorley Operations				
Premises	Mount Thorley Road				
	Mount Thorley NSW 2330				
EDI Link	https://apps.epa.nsw.gov.au/prpoeoapp/				
EPL Link	ViewPOEOLicence.aspx?DOCID=147438&S YSUID=1&LICID=1976				
No see of Occasion					
Name of Operation	Warkworth Coal Mine				
Environment Protection Licence	1376				
Licensee	Warkworth Mining Ltd				
	Warkworth Coal Mine				
Premises	Putty Road				
	Mount Thorley NSW 2330				
	http://app.epa.nsw.gov.au/prpoeoapp/Vi				
EPL Link	ewPOEOLicence.aspx?DOCID=121545&SY				
	SUID=1&LICID=1376				

1 INTRODUCTION

This report provides a summary of environmental monitoring results for Mount Thorley Warkworth (MTW) in accordance with the requirements of the following Environment Protection Licences (EPL):

- EPL24 Mount Thorley Coal Loader (MTCL);
- EPL1376 Warkworth Mining Limited (WML); and
- EPL1976 Mount Thorley Operations (MTO).

This report includes all monitoring data collected in accordance with the above licences for the period 1 to 31 August 2019.

Monitoring in this report includes:

- Air quality monitoring;
- Surface water monitoring including mine water discharge and effluent quality; and
- Blast monitoring.

Monitoring locations are shown in **Figure 1**.

2 AIR QUALITY

In accordance with the requirements of Condition M2.2 of WML EPL 1376 and MTO EPL 1976, MTW maintains a network of five PM_{10} monitors.

Results of Particulates (PM_{10}) monitoring are shown in **Table 1**. Results reported represent the 24hr average PM_{10} , derived from 10 minute PM_{10} values for the period midnight to midnight, for each calendar date during the reporting period. The last sampling date was 31 August 2019 and the data was obtained on 1 September 2019.

YANCOAL AUSTRALIA LTD PAGE 2 OF 12

TABLE 1: PARTICULATE MATTER < 10 µM MONITORING

		Monitoring	Monitoring Point								
Date	Unit of Measure	Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976)	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & EPA ID #19 - MTO EPL 1976)				
1/08/2019	μg/m³		10.0	6.3	12.4	6.8	3.1				
2/08/2019	μg/m³		10.8	8.7	14.4	11.0	5.2				
3/08/2019	μg/m³		14.4	14.0	21.7	16.1	8.2				
4/08/2019	μg/m³		21.5	15.6	24.4	18.3	#				
5/08/2019	μg/m³		20.1	19.3	32.9	20.7	10.0				
6/08/2019	μg/m³		6.7	10.0	25.1	15.7	4.1				
7/08/2019	μg/m³		9.1	14.6	43.3	20.5	#				
8/08/2019	μg/m³		10.0	8.0	26.2	13.7	5.6				
9/08/2019	μg/m³		4.8	6.9	15.4	5.2	3.4				
10/08/2019	μg/m³		11.2	4.0	11.8	3.3	1.1				
11/08/2019	μg/m³	Continuous	1.3	3.7	8.2	2.2	0.8				
12/08/2019	μg/m³		1.7	6.0	16.4	5.5	1.8				
13/08/2019	μg/m³		4.8	6.4	20.0	9.4	4.1				
14/08/2019	μg/m³		9.4	8.0	16.2	#	6.4				
15/08/2019	μg/m³		7.6	8.0	20.3	13.4	#				
16/08/2019	μg/m³	1	3.8	7.1	22.5	15.4	#				
17/08/2019	μg/m³		14.3	6.5	13.3	12.9	5.5				
18/08/2019	μg/m³		22.1	13.4	21.3	14.8	9.9				
19/08/2019	μg/m³	1	3.8	5.0	19.7	7.9	4.3				
20/08/2019	μg/m³		2.0	5.2	19.9	5.5	2.9				
21/08/2019	μg/m³		2.5	4.9	18.5	3.4	2.8				

YANCOAL AUSTRALIA LTD
PAGE 3 OF 12

		Monitorina			Monitoring Point		
Date Unit o	Unit of Measure	Monitoring Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976)	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & EPA ID #19 - MTO EPL 1976)
22/08/2019	μg/m³		8.4	6.8	13.8	7.0	6.3
23/08/2019	μg/m³		10.5	7.9	10.7	8.8	6.2
24/08/2019	μg/m³		10.3	15.3	32.7	19.1	9.7
25/08/2019	μg/m³		11.2	12.3	22.3	15.0	8.8
26/08/2019	μg/m³		15.4	10.4	9.8	10.3	11.9
27/08/2019	μg/m³		11.5	8.6	8.8	9.0	10.4
28/08/2019	μg/m³		10.3	8.6	12.5	8.2	7.2
29/08/2019	μg/m³		8.4	4.6	9.5	6.9	3.3
30/08/2019	μg/m³		2.9	0.6	0.5	0.4	0.1
31/08/2019	μg/m³		5.4	2.1	2.5	1.6	1.8
	·		N	Nonthly Meaningful Data			
August	μg/m³	Minimum*	1.3	0.6	0.5	0.4	0.1
August	μg/m³	Mean*	9.2	8.4	17.6	10.3	5.7
August	μg/m³	Maximum*	22.1	19.3	43.3	20.7	11.9
August	μg/m³	Median*	9.4	7.9	16.4	9.4	5.6

^{# 24} hour data unavailable due to equipment or communications issue causing one or more missing 10 minute values

YANCOAL AUSTRALIA LTD
PAGE 4 OF 12

^{*}Data calculated with missing 10 minute value(s) due to equipment or communication issue MTIE denotes Mount Thorley Industrial Estate

3 SURFACE WATER

3.1 Mine Water Discharge Monitoring

MTW participates in the Hunter River Salinity Trading Scheme (HRSTS) and maintains two monitoring locations associated with this scheme.

MTW did not receive any discharge opportunities in the reporting period and no water was discharged as shown in **Table 2**. As such, no samples were collected during the reporting period as shown in **Table 3**.

TABLE 2: MINE WATER DISCHARGE MONITORING - VOLUME AND MASS LIMITS

Monitoring Location	Unit of measure	Volume/mass Limit	Volume/mass Discharged
Dam 1N Discharge / Point 1 (WML EPL 1376) Dam 1N Discharge Point	Megalitres per day	100	-
Dam 9S Discharge / EPL Point 4 (MTO EPL 1976) Discharge pipe from Dam 9	Megalitres per day	100	-

YANCOAL AUSTRALIA LTD PAGE 5 OF 12

TABLE 3: MINE WATER DISCHARGE MONITORING- CONCENTRATION LIMITS

Discharge Point	Date	Pollutant	Unit of measure	Licence limits	No. of samples required by licence	No. of samples you collected and analysed
Dam 1N Discharge / Point 1		Electrical Conductivity	microsiemens per centimetre	-	0	0
(WML EPL 1376)	N/A	рН	рН	6.5 - 9.0	0	0
Dam 1N Discharge Point		Total Suspended Solids	milligrams per litre	120	0	0
Dam 9S Discharge / EPL Point 4		Electrical Conductivity	microsiemens per centimetre	-	0	0
(MTO EPL 1976)	N/A	рН	рН	6.5 - 9.0	0	0
Discharge pipe from Dam 9		Total Suspended Solids	milligrams per litre	120	0	0

3.2 Hunter River Tributaries Monitoring

MTW undertakes monitoring in Loders Creek, in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 4**. Monthly sampling occurred 20 August 2019 and the data was obtained 10 September 2019.

TABLE 4: HUNTER WATER TRIBUTARIES MONITORING

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples collected and analysed	Value
	Electrical Conductivity	microsiemens per centimetre	Once a month	0	#
W5 – Loders Creek / EPL Point 3	Liectrical Conductivity	inicrosiemens per centimetre	(min. of 4 weeks)	U	
(MTO EPL 1976)	рН	pH units	Once a month	0	#
Coal preparation plant access road bridge	ρπ	pri dilits	(min. of 4 weeks)	U	"
	Total Suspended Solids	milligrams per litre	Once a month	0	#
	Total Suspended Solids	minigrams per nue	(min. of 4 weeks)	U	#

^{# -} Sample unable to be collected due to insufficient water

YANCOAL AUSTRALIA LTD PAGE 6 OF 12

3.3 Effluent Quality Monitoring

MTO undertakes monitoring in the MTO receiving lagoon (Dam 1S), in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 5**. Sampling is undertaken on a quarterly basis and as such no sampling was conducted in August 2019.

TABLE 5: MTO EFFLUENT QUALITY MONITORING

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples collected and analysed	Value
Dam 1S / EPL Point 18	Faecal Coliforms	Colony forming units per 100 millilitres	Once a quarter	-	-
(MTO EPL 1976)	рН	pH units	Once a quarter	-	-

4 BLAST MONITORING

In accordance with the requirements of Conditions M7.1 (WML EPL 1376) and M8.1 (MTO EPL 1976), MTW maintains a network of blast monitors to measure airblast overpressure and ground vibration for all blasts carried out at MTW.

During the reporting period two blasts exceeded the 115dB(L) threshold for airblast overpressure at the Putty Road MTIE blast monitor on 6 and 20 August 2019. No blasts exceeded the 5mm/s threshold for ground vibration.

Blast monitoring results are detailed in **Table 6** (Airblast Overpressure) and **Table 7** (Ground Vibration). The last date sampled was on 30 August 2019. The data was obtained on 1 September 2019.

YANCOAL AUSTRALIA LTD
PAGE 7 OF 12

TABLE 6: BLAST MONITORING (AIRBLAST OVERPRESSURE)

			Monitoring Frequency & Capture	EPL L	imits	Monitoring Point				
Blast ID	Date and Time	Unit of Measure		95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-whf-pr10	2/08/2019 10:32	dB(L)		115	120	95.2	102.5	95.2	105.1	90.4
w33-wnd-ptg2	5/08/2019 13:04	dB(L)		115	120	100.9	95.0	96.8	91.1	99.0
n34-bfb-h-co1 & n34- wwa-ptg4	6/08/2019 12:45	dB(L)		115	120	103.5	101.5	115.2	110.2	108.5
w36-wba-ps2	6/08/2019 12:49	dB(L)		115	120	97.8	101.6	107.0	96.3	95.7
n45-wyc-pr1	7/08/2019 11:28	dB(L)		115	120	98.0	99.6	105.8	108.3	101.0
n39-gmb-pr4	7/08/2019 13:49	dB(L)	All Blasts	115	120	103.3	102.3	107.6	101.1	102.3
w28-wwk-maa-ptg1	12/08/2019 12:57	dB(L)	100%	115	120	105.5	96.9	109.0	98.8	105.1
w36-wba-pr1	12/08/2019 13:00	dB(L)		115	120	108.1	97.6	110.0	107.8	109.4
w33-wnd-ptg3	13/08/2019 12:37	dB(L)		115	120	106.6	93.4	103.8	99.2	92.4
n43-wba-pr12	15/08/2019 11:52	dB(L)		115	120	105.2	101.2	97.6	103.3	109.4
n45-wyc-ptg2	15/08/2019 11:53	dB(L)		115	120	106.5	94.7	98.8	97.3	106.9
w36-wba-pr2	16/08/2019 12:08	dB(L)		115	120	106.7	96.0	111.6	99.4	108.7

YANCOAL AUSTRALIA LTD
PAGE 8 OF 12

				EPL Li	imits	Monitoring Point				
Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n39-gmb-pr5	20/08/2019 12:10	dB(L)		115	120	100.6	108.0	116.1	94.3	104.9
n35-bfa-ps2 & w28- mac-j-co1	22/08/2019 11:41	dB(L)		115	120	103.1	92.8	110.4	93.1	109.6
w33-wnd-pr1	23/08/2019 12:16	dB(L)		115	120	99.3	101.6	95.9	99.5	96.0
n34-wwa-ptg5	26/08/2019 11:42	dB(L)		115	120	89.9	96.1	86.3	112.1	92.9
w33-wnd-pr2	27/08/2019 13:35	dB(L)		115	120	102.3	97.7	101.3	99.4	96.7
n39-gmb-pr6 & w29- wwe-ps1	29/08/2019 12:32	dB(L)		115	120	98.1	91.3	108.7	98.4	103.9
n45-wyc-ptg3	30/08/2019 9:04	dB(L)		115	120	91.1	100.5	103.6	103.9	110.4
w29-wwe-ps2	30/08/2019 11:46	dB(L)		115	120	91.1	94.8	109.3	98.8	108.0
				Monthly	/ Meaningful	Data				
Minimum	August	dB(L)		115	120	89.9	91.3	86.3	91.1	90.4
Mean	August	dB(L)		115	120	100.6	98.3	104.5	100.9	102.5
Maximum	August	dB(L)		115	120	108.1	108.0	116.1	112.1	110.4
Median	August	dB(L)		115	120	101.6	97.7	106.4	99.4	104.4

YANCOAL AUSTRALIA LTD
PAGE 9 OF 12

TABLE 7: BLAST MONITORING (GROUND VIBRATION)

			Monitoring Frequency & Capture	EPL L	imits	Monitoring Point				
Blast ID	Date and Time	Unit of Measure		95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-whf-pr10	2/08/2019 10:32	mm/s		5	10	0.9	1.3	0.3	2.9	0.4
w33-wnd-ptg2	5/08/2019 13:04	mm/s		5	10	0.3	0.2	0.1	0.1	0.4
n34-bfb-h-co1 & n34- wwa-ptg4	6/08/2019 12:45	mm/s		5	10	0.1	0.1	0.1	0.1	0.1
w36-wba-ps2	6/08/2019 12:49	mm/s		5	10	0.6	0.5	0.1	0.6	0.5
n45-wyc-pr1	7/08/2019 11:28	mm/s		5	10	0.2	0.2	0.1	0.3	0.1
n39-gmb-pr4	7/08/2019 13:49	mm/s	All Blasts	5	10	2.1	3.5	0.4	1.1	0.9
w28-wwk-maa-ptg1	12/08/2019 12:57	mm/s	100%	5	10	0.0	0.0	0.0	0.1	0.1
w36-wba-pr1	12/08/2019 13:00	mm/s		5	10	2.3	1.6	0.3	0.8	2.4
w33-wnd-ptg3	13/08/2019 12:37	mm/s		5	10	0.3	0.2	0.1	0.5	0.2
n43-wba-pr12	15/08/2019 11:52	mm/s		5	10	0.2	0.5	0.1	0.3	0.2
n45-wyc-ptg2	15/08/2019 11:53	mm/s		5	10	0.1	0.2	0.1	0.3	0.1
w36-wba-pr2	16/08/2019 12:08	mm/s		5	10	2.4	1.3	0.3	1.1	1.9

YANCOAL AUSTRALIA LTD
PAGE 10 OF 12

		Unit of Measure		EPL Li	imits	Monitoring Point				
Blast ID	Date and Time		Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n39-gmb-pr5	20/08/2019 12:10	mm/s		5	10	1.1	1.5	0.2	1.3	1.0
n35-bfa-ps2 & w28- mac-j-co1	22/08/2019 11:41	mm/s		5	10	0.5	1.1	0.2	0.9	0.6
w33-wnd-pr1	23/08/2019 12:16	mm/s		5	10	1.1	0.7	0.1	0.4	0.8
n34-wwa-ptg5	26/08/2019 11:42	mm/s		5	10	0.1	0.1	0.0	0.1	0.1
w33-wnd-pr2	27/08/2019 13:35	mm/s		5	10	1.0	0.8	0.1	0.2	0.5
n39-gmb-pr6 & w29- wwe-ps1	29/08/2019 12:32	mm/s		5	10	0.5	0.4	0.2	0.4	0.8
n45-wyc-ptg3	30/08/2019 9:04	mm/s		5	10	0.1	0.2	0.0	0.4	0.1
w29-wwe-ps2	30/08/2019 11:46	mm/s		5	10	0.8	0.4	0.1	0.6	1.1
				Monthly	/ Meaningful	Data				
Minimum	August	mm/s		5	10	0.04	0.03	0.03	0.05	0.05
Mean	August	mm/s		5	10	0.73	0.74	0.14	0.62	0.60
Maximum	August	mm/s		5	10	2.38	3.52	0.36	2.88	2.44
Median	August	mm/s		5	10	0.52	0.45	0.13	0.42	0.45

YANCOAL AUSTRALIA LTD
PAGE 11 OF 12

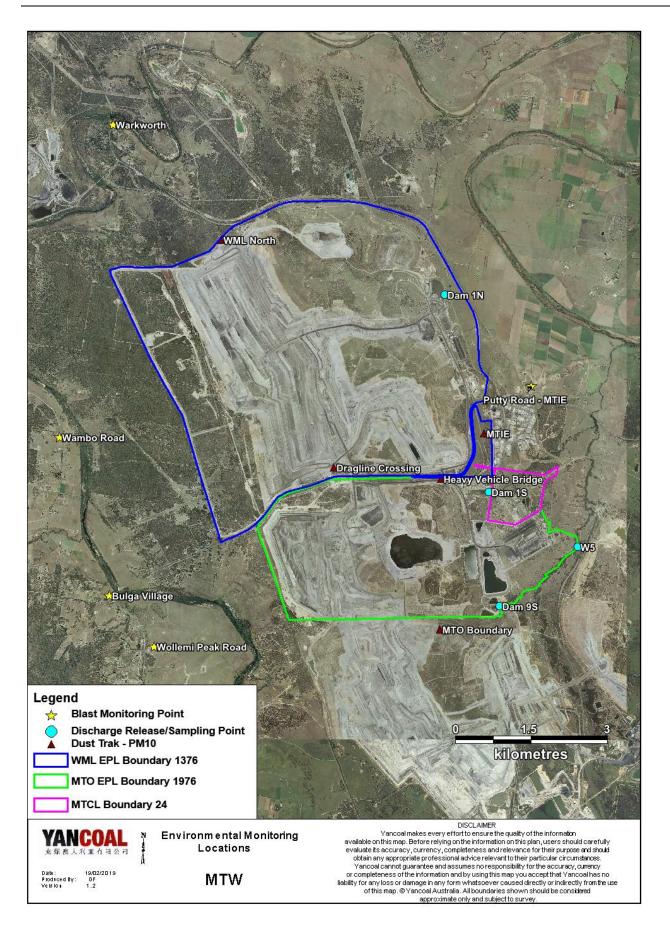


Figure 1: Mount Thorley Warkworth Environmental Monitoring Locations

YANCOAL AUSTRALIA LTD PAGE 12 OF 12