



Mount Thorley Warkworth EPL Monitoring Data

Published 19 September 2018 FOR THE MONTH ENDING 31 August 2018

Name of Operation	Mount Thorley Coal Loader
Environment Protection Licence	24
Licensee	Mount Thorley Coal Loading Ltd
Premises	Mount Thorley Coal Loading Ltd Mount Thorley Road, Mount Thorley Via Singleton NSW 2330
EPL Link	http://app.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=89660&SYSUID=1&LICID=24
Name of Operation	Mount Thorley Operations
Environment Protection Licence	1976
Licensee	Mount Thorley Operations Pty Limited
Premises	Mount Thorley Operations Mount Thorley Road Mount Thorley NSW 2330
EPL Link	http://app.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=123990&SYSUID=1&LICID=1976
Name of Operation	Warkworth Coal Mine
Environment Protection Licence	1376
Licensee	Warkworth Mining Ltd
Premises	Warkworth Coal Mine Putty Road Mount Thorley NSW 2330
EPL Link	http://app.epa.nsw.gov.au/prpoeoapp/ViewPOEOLicence.aspx?DOCID=121545&SYSUID=1&LICID=1376

1 INTRODUCTION

This report provides a summary of environmental monitoring results for Mount Thorley Warkworth (MTW) in accordance with the requirements of the following Environment Protection Licences (EPL):

- EPL24 Mount Thorley Coal Loader (MTCL);
- EPL1376 Warkworth Mining Limited (WML); and
- EPL1976 Mount Thorley Operations (MTO).

This report includes all monitoring data collected in accordance with the above licences for the period 1 to 31 August 2018.

Monitoring in this report includes:

- Air quality monitoring;
- Surface water monitoring including mine water discharge and effluent quality; and
- · Blast monitoring.

Monitoring locations are shown in Figure 1.

2 AIR QUALITY

In accordance with the requirements of Condition M2.2 of WML EPL 1376 and MTO EPL 1976, MTW maintains a network of five PM₁₀ monitors.

Results of Particulates (PM_{10}) monitoring are shown in **Table 1**. Results reported represent the 24hr average PM_{10} , derived from 10 minute PM_{10} values for the period midnight to midnight, for each calendar date during the reporting period. The last sampling date was 31 August 2018 and the data was obtained on 3rd September 2018.

YANCOAL AUSTRALIA LTD PAGE 2 OF 16

TABLE 1: PARTICULATE MATTER <10μM MONITORING

		Monitoring			Monitoring Point		
Date	Unit of Measure	Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976)	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & MTO EPL 1976)
1/08/2018	μg/m³		9.1	9.2	26.1	12.6	7.7
2/08/2018	μg/m³	-	26.3	14.6	17.5	18.9	15.3
3/08/2018	μg/m³		28.1	26.3	56.0	37.7	35.3
4/08/2018	μg/m³	-	15.2	16.2	38.5	21.3	18.6
5/08/2018	μg/m³	-	8.4	9.5	39.4	17.7	18.7
6/08/2018	μg/m³	=	15.9	10.4	27.4	14.6	16.0
7/08/2018	μg/m³	-	5.6	7.7	26.0	10.5	7.5
8/08/2018	μg/m³	-	3.0	6.1	29.8	9.5	5.5
9/08/2018	μg/m³	-	7.4	6.0	30.4	16.3	11.1
10/08/2018	μg/m³	-	11.2	12.2	47.6	25.5	23.4
11/08/2018	μg/m³	Continuous	16.4	15.1	60.2	27.3	26.6
12/08/2018	μg/m³	-	1.3	2.4	16.3	5.0	#
13/08/2018	μg/m³	-	2.5	5.2	27.9	6.8	4.5
14/08/2018	μg/m³	-	4.3	9.8	33.9	6.2	5.3
15/08/2018	μg/m³	-	5.3	10.1	41.1	8.4	8.6
16/08/2018	μg/m³		7.3	9.2	36.1	7.4	6.7
17/08/2018	μg/m³	-	10.6	7.4	31.1	20.1	18.4
18/08/2018	μg/m³	-	5.5	7.7	38.6	15.0	10.9
19/08/2018	μg/m³	-	2.7	3.8	23.1	9.3	4.6
20/08/2018	μg/m³	-	6.0	7.9	27.6	16.0	9.3
21/08/2018	μg/m³	-	3.6	5.9	29.2	8.8	5.6

YANCOAL AUSTRALIA LTD

PAGE 3 OF 16

		Monitoring	Monitoring Point								
Date Unit of Measure	Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976)	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & MTO EPL 1976)					
22/08/2018	μg/m³		7.9	9.7	23.5	11.4	8.1				
23/08/2018	μg/m³		27.3	14.5	30.8	22.2	22.1				
24/08/2018	μg/m³		26.0	15.9	22.4	21.9	22.0				
25/08/2018	μg/m³		19.3	11.1	14.8	13.6	13.0				
26/08/2018	μg/m³		21.8	13.8	19.9	19.3	18.6				
27/08/2018	μg/m³		16.9	13.8	23.5	24.5	18.5				
28/08/2018	μg/m³		14.7	10.9	18.1	15.3	13.5				
29/08/2018	μg/m³		16.0	14.3	29.1	20.3	18.6				
30/08/2018	μg/m³		18.2	10.8	20.0	16.0	15.8				
31/08/2018	μg/m³		21.5	16.8	26.4	19.3	20.5				
		I	N	Monthly Meaningful Data			1				
August	μg/m³	Minimum*	1.3	2.4	14.8	5.0	4.5				
August	μg/m³	Mean*	12.4	10.8	30.1	16.1	14.3				
August	μg/m³	Maximum*	28.1	26.3	60.2	37.7	35.3				
August	μg/m³	Median*	10.6	10.1	27.9	16.0	14.4				

^{# 24} hour data unavailable due to equipment or communications issue causing one or more missing 10 minute values

YANCOAL AUSTRALIA LTD
PAGE 4 OF 16

^{*}Data calculated with missing 10 minute value(s) due to equipment or communication issue MTIE denotes Mount Thorley Industrial Estate

3 SURFACE WATER

3.1 Mine Water Discharge Monitoring

MTW participates in the Hunter River Salinity Trading Scheme (HRSTS) and maintains two monitoring locations associated with this scheme.

MTW did not receive any discharge opportunities in the reporting period and no water was discharged as shown in **Table 2**. As such, no samples were collected during the reporting period as shown in **Table 3**.

TABLE 2: MINE WATER DISCHARGE MONITORING - VOLUME AND MASS LIMITS

Monitoring Location	Unit of measure	Volume/mass Limit	Volume/mass Discharged
Dam 9S Discharge / EPL Point 4 (MTO EPL 1976) Discharge pipe from Dam 9	Megalitres per day	100	-

TABLE 3: MINE WATER DISCHARGE MONITORING- CONCENTRATION LIMITS

Discharge Point	Date	Pollutant	Unit of measure	Licence limits	No. of samples required by licence	No. of samples you collected and analysed
Dam 1N Discharge / Point 1		Electrical Conductivity	microsiemens per centimetre	-	0	0
(WML EPL 1376)	N/A	рН	рН	6.5 - 9.0	0	0
Dam 1N Discharge Point		Total Suspended Solids	milligrams per litre	120	0	0
Dam 9S Discharge / EPL Point 4		Electrical Conductivity	microsiemens per centimetre	-	0	0
	N/A	рН	рН	6.5 - 9.0	0	0
Discharge pipe from Dam 9		Total Suspended Solids	milligrams per litre	120	0	0

YANCOAL AUSTRALIA LTD PAGE 5 OF 16

3.2 Hunter River Tributaries Monitoring

MTW undertakes monitoring in Loders Creek, in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 4**. Monthly sampling occurred 22 August 2018 and the data was obtained 11 September 2018.

TABLE 4: HUNTER WATER TRIBUTARIES MONITORING

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples you collected and analysed	Value
	Electrical Conductivity	microsiemens per centimetre	Once a month	0	#
W5 – Loders Creek / EPL Point 3	Electrical Conductivity	microsiemens per centimetre	(min. of 4 weeks)	U	#
(MTO EPL 1976)	На	pH units	Once a month	0	#
Coal preparation plant access road bridge	рп	ph units	(min. of 4 weeks)	U	#
	Tatal Cuspended Calida	maillianna man litura	Once a month	0	ш
	Total Suspended Solids	milligrams per litre	(min. of 4 weeks)	Ü	#

^{# -} Sample unable to be collected due to insufficient water

YANCOAL AUSTRALIA LTD

PAGE 6 OF 16

3.3 Effluent Quality Monitoring

MTO undertakes monitoring in the MTO receiving lagoon (Dam 1S), in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 5**. Sampling is undertaken on a quarterly basis and as such no sampling was conducted in August 2018. The next sampling event will be in September 2018.

TABLE 5: EFFLUENT QUALITY MONITORING

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples you collected and analysed	Value
Dam 1S / EPL Point 18	Faecal Coliforms	Colony forming units per 100 millilitres	Once a quarter	-	-
(MTO EPL 1976)	рН	pH units	Once a quarter	-	-

4 BLAST MONITORING

In accordance with the requirements of Conditions M7.1 (WML EPL 1376) and M8.1 (MTO EPL 1976), MTW maintains a network of blast monitors to measure airblast overpressure and ground vibration for all blasts carried out at MTW.

During the reporting period one blast exceeded the 115dB(L) threshold for airblast overpressure at the Wollemi Peak Road blast monitor on the 14th August 2018 and no blasts exceeded the 5mm/s threshold for ground vibration.

Blast monitoring results are detailed in **Table 6** (Airblast Overpressure) and **Table 7** (Ground Vibration). The last date sampled was on 31 August 2018. The data was obtained on 17 September 2018.

YANCOAL AUSTRALIA LTD PAGE 7 OF 16

TABLE 6: BLAST MONITORING (AIRBLAST OVERPRESSURE)

				EPL L	imits			Monitoring Poin	t	
Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
l52-ble-ptg7 & l51- gmawhd-co1	1/08/2018 12:27	dB(L)		115	120	103.3	100.1	97.9	99.9	106.6
n37-gmb-pr7	3/08/2018 10:33	dB(L)		115	120	97.7	96.4	110.4	95.3	99.3
w36-rcd-pr2	7/08/2018 10:23	dB(L)		115	120	105.0	98.2	111.4	100.7	108.1
l51-gma-md3	8/08/2018 12:09	dB(L)		115	120	113.4	97.7	110.4	97.7	114.0
w28-bff-wwc-co1	8/08/2018 13:30	dB(L)		115	120	101.7	91.6	110.9	95.7	97.0
w27-wwe-ps5	10/08/2018 12:08	dB(L)	All Blasts 100%	115	120	99.3	103.1	86.9	85.6	105.8
w34-wba-pr4	10/08/2018 12:09	dB(L)		115	120	99.9	105.9	94.0	88.0	104.3
l53-wba-ps1	14/08/2018 12:20	dB(L)		115	120	97.2	101.7	107.9	108.1	106.3
n45-rca-ps1 & n41-bla- ptg1	14/08/2018 13:23	dB(L)		115	120	101.9	99.7	96.8	92.1	115.4
w27-wwe-md3	16/08/2018 12:35	dB(L)		115	120	91.6	103.7	108.0	95.2	102.6
w36-rcd-pr3	16/08/2018 12:35	dB(L)		115	120	107.8	101.5	109.1	94.7	107.1

YANCOAL AUSTRALIA LTD

PAGE 8 OF 16

				EPL L	imits	Monitoring Point					
Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)	
w31-gmd-ptg1	17/08/2018 10:44	dB(L)		115	120	89.2	94.2	96.7	91.3	107.3	
l53-wba-pr1	17/08/2018 12:15	dB(L)		115	120	97.8	94.5	105.5	105.0	99.6	
I52-gma-ps1 & I51-gma- whd-co2	21/08/2018 12:11	dB(L)		115	120	107.3	104.8	111.1	106.4	96.0	
n35-whf-ptg1 & n43- wba-ps6	22/08/2018 12:41	dB(L)		115	120	102.2	94.0	91.0	92.8	104.4	
w28-wwe-ps1	23/08/2018 12:49	dB(L)		115	120	102.7	87.8	94.2	93.4	96.4	
n41-bla-ptg2	24/08/2018 10:19	dB(L)		115	120	89.0	96.0	91.4	97.8	89.5	
w31-wha-c-co1	24/08/2018 11:41	dB(L)		115	120	93.7	100.5	90.5	98.7	93.1	
l52-gma-md1	28/08/2018 12:12	dB(L)		115	120	96.5	91.4	93.4	91.0	96.7	
n41-bla-ptg3	29/08/2018 12:32	dB(L)		115	120	104.3	98.6	99.3	92.5	103.1	
n43-wba-ps7	29/08/2018 12:32	dB(L)		115	120	97.5	98.6	95.6	88.3	103.1	
l52-gma-md2	30/08/2018 11:46	dB(L)		115	120	101.2	96.0	90.9	88.5	102.4	
w31-wha-c-co2	31/08/2018 9:41	dB(L)		115	120	85.7	77.2	83.2	90.7	78.9	

YANCOAL AUSTRALIA LTD

PAGE 9 OF 16

				EPL L	imits	Monitoring Point					
Blast ID Date	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)	
w27-wwe-ps6	31/08/2018 11:55	dB(L)		115	120	87.7	89.4	94.8	92.1	88.9	
				Monthly	/ Meaningful I	Data					
Minimum	August	dB(L)		115	120	85.7	77.2	83.2	85.6	78.9	
Mean	August	dB(L)		115	120	98.9	96.8	99.2	95.1	100.9	
Maximum	August	dB(L)		115	120	113.4	105.9	111.4	108.1	114.0	
Median	August	dB(L)		115	120	99.6	98.0	96.8	94.1	102.9	

YANCOAL AUSTRALIA LTD

PAGE 10 OF 16

TABLE 7: BLAST MONITORING (GROUND VIBRATION)

				EPL L	imits			Monitoring Poin	t	
Blast ID I	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
I52-ble-ptg7 & I51- gmawhd-co1	1/08/2018 12:27	mm/s		5	10	0.2	0.1	0.0	0.1	0.1
n37-gmb-pr7	3/08/2018 10:33	mm/s		5	10	1.1	1.3	0.2	1.1	0.9
w36-rcd-pr2	7/08/2018 10:23	mm/s		5	10	3.8	1.1	0.3	0.5	1.6
l51-gma-md3	8/08/2018 12:09	mm/s		5	10	1.5	0.9	0.2	0.3	1.5
w28-bff-wwc-co1	8/08/2018 13:30	mm/s		5	10	0.2	0.1	0.0	0.3	0.1
w27-wwe-ps5	10/08/2018 12:08	mm/s	All Blasts 100%	5	10	0.7	1.0	0.2	0.6	0.7
w34-wba-pr4	10/08/2018 12:09	mm/s		5	10	2.2	1.0	0.2	0.6	1.0
l53-wba-ps1	14/08/2018 12:20	mm/s		5	10	0.7	0.3	0.2	0.2	0.3
n45-rca-ps1 & n41-bla- ptg1	14/08/2018 13:23	mm/s		5	10	0.4	0.5	0.1	0.3	0.2
w27-wwe-md3	16/08/2018 12:35	mm/s		5	10	2.1	0.8	0.3	0.4	1.0
w36-rcd-pr3	16/08/2018 12:35	mm/s		5	10	3.0	0.9	0.2	0.3	1.3

YANCOAL AUSTRALIA LTD

PAGE 11 OF 16

				EPL L	imits			Monitoring Poin	t	
Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
w31-gmd-ptg1	17/08/2018 10:44	mm/s		5	10	0.1	0.1	0.0	0.1	0.1
l53-wba-pr1	17/08/2018 12:15	mm/s		5	10	0.3	0.2	0.1	0.1	0.2
I52-gma-ps1 & I51-gma- whd-co2	21/08/2018 12:11	mm/s		5	10	0.8	0.4	0.2	0.2	0.6
n35-whf-ptg1 & n43- wba-ps6	22/08/2018 12:41	mm/s		5	10	0.7	0.8	0.1	0.3	0.4
w28-wwe-ps1	23/08/2018 12:49	mm/s		5	10	1.6	0.5	0.1	0.3	0.9
n41-bla-ptg2	24/08/2018 10:19	mm/s		5	10	0.0	0.1	0.0	0.3	0.0
w31-wha-c-co1	24/08/2018 11:41	mm/s		5	10	0.1	0.1	0.0	0.1	0.0
l52-gma-md1	28/08/2018 12:12	mm/s		5	10	1.3	0.5	0.1	0.2	0.9
n41-bla-ptg3	29/08/2018 12:32	mm/s		5	10	0.5	1.0	0.2	0.3	0.5
n43-wba-ps7	29/08/2018 12:32	mm/s		5	10	0.5	1.0	0.2	0.3	0.5
l52-gma-md2	30/08/2018 11:46	mm/s		5	10	1.7	0.9	0.2	0.4	1.0
w31-wha-c-co2	31/08/2018 9:41	mm/s		5	10	0.0	0.0	0.0	0.2	0.0

YANCOAL AUSTRALIA LTD
PAGE 12 OF 16

Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	EPL Limits		Monitoring Point				
				95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
w27-wwe-ps6	31/08/2018 11:55	mm/s		5	10	0.8	0.5	0.2	0.5	0.4
Monthly Meaningful Data										
Minimum	August	mm/s		5	10	0.03	0.03	0.03	0.07	0.03
Mean	August	mm/s		5	10	1.00	0.57	0.13	0.33	0.59
Maximum	August	mm/s		5	10	3.79	1.34	0.26	1.13	1.62
Median	August	mm/s		5	10	0.70	0.50	0.16	0.28	0.47

YANCOAL AUSTRALIA LTD

PAGE 13 OF 16

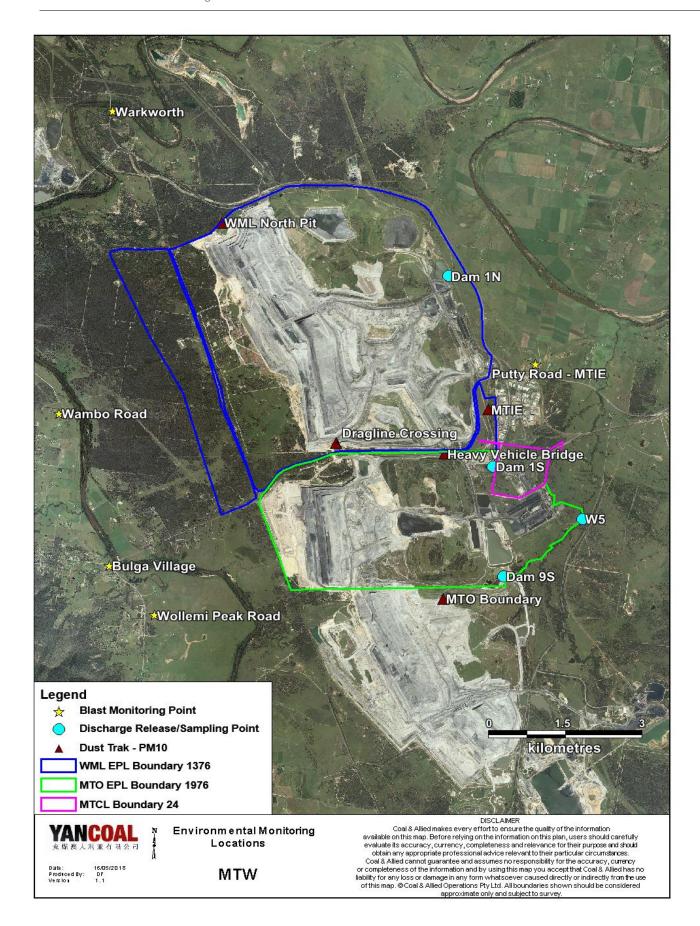


Figure 1: Mount Thorley Warkworth Environmental Monitoring Locations

YANCOAL AUSTRALIA LTD PAGE 14 OF 16

MTW EPL Monitoring Data

FOR THE MONTH ENDING 31 August 2018

YANCOAL AUSTRALIA LTD PAGE 15 OF 16

Correction Log

EPA Point ID	Pollutant	Sample Date	Original Value	Corrected Data	Date Corrected	Date Originally Published	Reason
Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)	Blast Overpressure (dB(L))	14/08/2018 13:23	110.62	115.4	17/10/2018	28/09/2018	For blast ID w28-bfe-ptg1, there was a revision error in the airblast overpressure calculation when importing the data.

YANCOAL AUSTRALIA LTD PAGE 16 OF 16