

# Mount Thorley Warkworth EPL Monitoring Data

Published 16 January 2019 FOR THE MONTH ENDING 31 DECEMBER 2018

Name of Operation	Mount Thorley Coal Loader
Environment Protection Licence	24
Licensee	Mount Thorley Coal Loading Ltd
	Mount Thorley Coal Loading Ltd
Premises	Mount Thorley Road, Mount Thorley
	Via Singleton NSW 2330  http://app.epa.nsw.gov.au/prpoeoapp/Vi
EPL Link	ewPOEOLicence.aspx?DOCID=89660&SYS
	UID=1&LICID=24
Name of Operation	Mount Thorley Operations
Environment Protection Licence	1976
Licensee	Mount Thorley Operations Pty Limited
	Mount Thorley Operations
Premises	Mount Thorley Road
	Mount Thorley NSW 2330
50.41.1	https://apps.epa.nsw.gov.au/prpoeoapp/
EPL Link	ViewPOEOLicence.aspx?DOCID=147438&S
	YSUID=1&LICID=1976
Name of Operation	Warkworth Coal Mine
Environment Protection Licence	1376
Licensee	Warkworth Mining Ltd
	Warkworth Coal Mine
Premises	Putty Road
	Mount Thorley NSW 2330
	http://app.epa.nsw.gov.au/prpoeoapp/Vi
EPL Link	ewPOEOLicence.aspx?DOCID=121545&SY
	SUID=1&LICID=1376

### 1 INTRODUCTION

This report provides a summary of environmental monitoring results for Mount Thorley Warkworth (MTW) in accordance with the requirements of the following Environment Protection Licences (EPL):

- EPL24 Mount Thorley Coal Loader (MTCL);
- EPL1376 Warkworth Mining Limited (WML); and
- EPL1976 Mount Thorley Operations (MTO).

This report includes all monitoring data collected in accordance with the above licences for the period 1 to 31 December 2018.

Monitoring in this report includes:

- Air quality monitoring;
- Surface water monitoring including mine water discharge and effluent quality; and
- Blast monitoring.

Monitoring locations are shown in **Figure 1**.

## 2 AIR QUALITY

In accordance with the requirements of Condition M2.2 of WML EPL 1376 and MTO EPL 1976, MTW maintains a network of five  $PM_{10}$  monitors.

Results of Particulates ( $PM_{10}$ ) monitoring are shown in **Table 1**. Results reported represent the 24hr average  $PM_{10}$ , derived from 10 minute  $PM_{10}$  values for the period midnight to midnight, for each calendar date during the reporting period. The last sampling date was 31 December 2018 and the data was obtained on 1 January 2019.

YANCOAL AUSTRALIA LTD PAGE 2 OF 14

TABLE 1: PARTICULATE MATTER < 10 µM MONITORING

		Monitoring	Monitoring Point  Monitoring							
Date	Unit of Measure	Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976 )	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & EPA ID #19 - MTO EPL 1976)			
1/12/2018	μg/m³		13.4	8.5	11.7	14.5	14.6			
2/12/2018	μg/m³		9.8	9.7	29.9	16.1	19.8			
3/12/2018	μg/m³		8.4	7.2	20.8	11.9	15.3			
4/12/2018	μg/m³		9.1	6.2	21.6	16.3	17.2			
5/12/2018	μg/m³		12.1	6.8	9.4	10.0	12.0			
6/12/2018	μg/m³	-	8.5	3.7	4.9	9.9	6.2			
7/12/2018	μg/m³		8.2	4.2	5.1	6.1	5.0			
8/12/2018	μg/m³		11.8	5.3	8.3	8.9	8.0			
9/12/2018	μg/m³		15.6	9.8	14.1	15.1	14.1			
10/12/2018	μg/m³		18.8	10.8	12.2	14.7	17.3			
11/12/2018	μg/m³	Continuous	19.7	12.8	15.2	17.5	24.2			
12/12/2018	μg/m³		21.9	10.1	13.1	14.3	19.7			
13/12/2018	μg/m³		10.0	9.0	14.8	13.2	15.2			
14/12/2018	μg/m³		19.4	11.7	17.2	21.3	22.0			
15/12/2018	μg/m³	1	19.5	11.7	18.5	24.1	22.3			
16/12/2018	μg/m³	1	9.9	6.9	15.5	15.9	14.3			
17/12/2018	μg/m³	1	11.1	7.4	12.0	12.5	11.5			
18/12/2018	μg/m³	1	24.0	14.9	16.8	24.8	25.4			
19/12/2018	μg/m³	1	21.6	14.4	18.5	28.4	26.8			
20/12/2018	μg/m³	1	18.3	12.9	21.8	21.3	22.3			
21/12/2018	μg/m³	1	12.4	6.0	7.7	12.4	11.6			

YANCOAL AUSTRALIA LTD

PAGE 3 OF 14

		Monitoring			<b>Monitoring Point</b>		
Date	Unit of Measure	Frequency & Capture	Warkworth North (EPA ID # 9 - WML EPL 1376)	MTO Boundary (EPA ID # 13 - MTO EPL 1976 )	Dragline Crossing (EPA ID # 10 - WML EPL 1376 & MTO EPL 1976)	Heavy Vehicle Bridge (EPA ID # 11 - WML EPL 1376 & MTO EPL 1976)	MTIE (EPA ID # 12 - WML EPL 1376 & EPA ID #19 - MTO EPL 1976)
22/12/2018	μg/m³		8.4	3.7	9.0	6.9	7.4
23/12/2018	μg/m³		#	#	3.6	#	4.5
24/12/2018	μg/m³		9.1	#	5.0	#	5.1
25/12/2018	μg/m³		4.8	3.6	5.6	6.3	5.7
26/12/2018	μg/m³		11.1	5.6	6.2	10.4	8.4
27/12/2018	μg/m³		12.8	7.1	16.4	19.4	10.1
28/12/2018	μg/m³		13.3	7.4	21.4	15.3	11.9
29/12/2018	μg/m³		12.5	7.8	20.7	12.8	12.4
30/12/2018	μg/m³		15.0	9.7	24.6	14.4	15.4
31/12/2018	μg/m³		25.2	18.7	29.0	22.3	26.3
	•	<u>'</u>	N	Nonthly Meaningful Data			•
December	μg/m³	Minimum*	4.8	3.6	3.6	6.1	4.5
December	μg/m³	Mean*	13.6	8.7	14.5	14.8	14.6
December	μg/m³	Maximum*	25.2	18.7	29.9	28.4	26.8
December	μg/m³	Median*	12.4	7.8	14.8	14.5	14.3

<sup># 24</sup> hour data unavailable due to equipment or communications issue causing one or more missing 10 minute values

MTIE denotes Mount Thorley Industrial Estate

YANCOAL AUSTRALIA LTD PAGE 4 OF 14

<sup>\*</sup>Data calculated with missing 10 minute value(s) due to equipment or communication issue

### **3 SURFACE WATER**

# 3.1 Mine Water Discharge Monitoring

MTW participates in the Hunter River Salinity Trading Scheme (HRSTS) and maintains two monitoring locations associated with this scheme.

MTW did not receive any discharge opportunities in the reporting period and no water was discharged as shown in **Table 2**. As such, no samples were collected during the reporting period as shown in **Table 3**.

TABLE 2: MINE WATER DISCHARGE MONITORING - VOLUME AND MASS LIMITS

Monitoring Location	Unit of measure	Volume/mass Limit	Volume/mass Discharged
Dam 9S Discharge / EPL Point 4 (MTO EPL 1976) Discharge pipe from Dam 9	Megalitres per day	100	-

TABLE 3: MINE WATER DISCHARGE MONITORING- CONCENTRATION LIMITS

Discharge Point	Date	Pollutant	Unit of measure	Licence limits	No. of samples required by licence	No. of samples you collected and analysed
Dam 1N Discharge / Point 1		Electrical Conductivity	microsiemens per centimetre	-	0	0
(WML EPL 1376)	WML EPL 1376) N/A		рН	6.5 - 9.0	0	0
Dam 1N Discharge Point		Total Suspended Solids	milligrams per litre	120	0	0
Dam 9S Discharge / EPL Point 4		Electrical Conductivity	microsiemens per centimetre	-	0	0
(MTO EPL 1976)	N/A	рН	рН	6.5 - 9.0	0	0
Discharge pipe from Dam 9		Total Suspended Solids	milligrams per litre	120	0	0

YANCOAL AUSTRALIA LTD

PAGE 5 OF 14

# 3.2 Hunter River Tributaries Monitoring

MTW undertakes monitoring in Loders Creek, in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 4**. Monthly sampling occurred 13 December 2018 and the data was obtained 7 January 2019.

TABLE 4: HUNTER WATER TRIBUTARIES MONITORING

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples you collected and analysed	Value
	Electrical Conductivity	microsiemens per centimetre	Once a month	0	#
W5 – Loders Creek / EPL Point 3	Electrical Conductivity	microsiemens per centimetre	(min. of 4 weeks)	U	#
(MTO EPL 1976)	nH	pH units	Once a month	0	#
Coal preparation plant access road bridge	рН	pn units	(min. of 4 weeks)	U	#
	Total Suspended Solids	milligrams nor litro	Once a month	0	#
	Total Suspended Solids	milligrams per litre	(min. of 4 weeks)	U	#

<sup># -</sup> Sample unable to be collected due to insufficient water

YANCOAL AUSTRALIA LTD
PAGE 6 OF 14

# 3.3 Effluent Quality Monitoring

MTO undertakes monitoring in the MTO receiving lagoon (Dam 1S), in accordance with Condition M2.3 of MTO EPL 1976 as detailed in **Table 5**. Monthly sampling occurred 18 December 2018 and the data was obtained 7 January 2019.

**TABLE 5: EFFLUENT QUALITY MONITORING** 

Monitoring Location	Pollutant	unit of measure	Monitoring frequency required by licence	No. of samples you collected and analysed	Value
Dam 1S / EPL Point 18	Faecal Coliforms	Colony forming units per 100 millilitres	Once a quarter	1	<91
(MTO EPL 1976)	рН	pH units	Once a quarter	1	9.2

### 4 BLAST MONITORING

In accordance with the requirements of Conditions M7.1 (WML EPL 1376) and M8.1 (MTO EPL 1976), MTW maintains a network of blast monitors to measure airblast overpressure and ground vibration for all blasts carried out at MTW.

During the reporting period one blast exceeded the 115dB(L) threshold for airblast overpressure at the Wollemi Peak Road blast monitor on 28 December 2018. This blast also exceeded the 120dB(L) threshold for airblast overpressure at the Bulga Village blast monitor, and was immediately reported to the EPA. A written report was also provided to the EPA for this blast which noted that wind gusts produced substantial air pressure peaks both before and during the blast which increased air pressure levels recorded at the Bulga Village monitor. No blasts exceeded the 5mm/s threshold for ground vibration.

Blast monitoring results are detailed in **Table 6** (Airblast Overpressure) and **Table 7** (Ground Vibration). The last date sampled was on 31 December 2018. The data was obtained on 1 January 2018.

YANCOAL AUSTRALIA LTD
PAGE 7 OF 14

TABLE 6: BLAST MONITORING (AIRBLAST OVERPRESSURE)

				EPL L	imits			Monitoring Poin	t	
Blast ID Date and Time	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-wha-ptg1	3/12/2018 12:25	dB(L)		115	120	99.0	103.3	98.3	94.3	96.6
w34-wba-ps5	3/12/2018 13:51	dB(L)		115	120	94.0	98.8	105.9	94.6	96.2
w27-wwe-k-co	4/12/2018 12:37	dB(L)		115	120	102.8	101.1	99.6	88.9	105.1
w36-rcd-pr4	5/12/2018 11:32	dB(L)		115	120	108.5	109.6	108.1	104.7	101.1
n45-rca-pr1	5/12/2018 12:48	dB(L)		115	120	104.8	110.2	105.4	112.3	101.1
n32-wwa-ptg3	6/12/2018 14:41	dB(L)	All Blasts 100%	115	120	107.8	100.8	112.0	108.3	98.6
w34-rcf-pr1	7/12/2018 9:25	dB(L)		115	120	104.4	106.8	90.8	90.7	104.1
n37-wha-ptg2	11/12/2018 11:14	dB(L)		115	120	88.0	92.7	86.6	102.3	80.7
w30-gmb-pr5	11/12/2018 13:17	dB(L)		115	120	106.3	101.3	101.4	99.3	103.2
w38-wyc-pr4	13/12/2018 10:34	dB(L)		115	120	104.0	99.3	95.7	96.2	101.1
l53-bla-md2	14/12/2018 9:42	dB(L)		115	120	101.3	102.7	96.8	89.4	103.4

YANCOAL AUSTRALIA LTD

PAGE 8 OF 14

				EPL L	imits			Monitoring Poin	t	
Blast ID Date a	Date and Time	Unit of Measure	Frequency	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-wha-c-co3	14/12/2018 11:39	dB(L)		115	120	93.8	92.3	96.0	97.8	94.3
n32-wwa-ptg4	15/12/2018 13:18	dB(L)		115	120	92.4	100.9	91.5	105.0	89.0
n34-bfa-ps1	17/12/2018 13:08	dB(L)		115	120	96.1	85.6	88.0	84.9	99.4
n41-wnd-ptg3	18/12/2018 11:35	dB(L)		115	120	88.6	93.3	92.5	103.0	89.5
w28-wwe-ps3	19/12/2018 13:32	dB(L)		115	120	95.6	100.2	88.6	85.5	94.7
w28-wwe-ps3 re-fire	19/12/2018 14:51	dB(L)		115	120	96.9	98.7	105.6	90.1	95.8
n37-gmb-pr11 & n41- bla-ptg10	21/12/2018 13:14	dB(L)		115	120	100.4	102.4	95.6	110.8	96.1
w28-wwe-ps4 & w28- wwe-md1	28/12/2018 12:02	dB(L)		115	120	102.6	102.7	106.7	106.5	104.2
w38-wyc-pr5	28/12/2018 12:03	dB(L)		115	120	120.1	109.4	109.9	93.0	116.5
n41-bla-ptg11	29/12/2018 11:12	dB(L)		115	120	90.9	100.0	102.0	91.4	106.6
n32-bfb-ptg2	31/12/2018 12:37	dB(L)		115	120	85.4	97.7	100.3	91.0	82.0
				Monthly	/ Meaningful	Data				

YANCOAL AUSTRALIA LTD

PAGE 9 OF 14

			Frequency	EPL Limits		Monitoring Point					
Blast ID	Date and Time	Time Unit of Measure		95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)	
Minimum	December	dB(L)		115	120	85.4	85.6	86.6	84.9	80.7	
Mean	December	dB(L)		115	120	99.3	100.4	99.0	97.3	98.1	
Maximum	December	dB(L)		115	120	120.1	110.2	112.0	112.3	116.5	
Median	December	dB(L)		115	120	99.7	100.8	99.0	95.4	99.0	

YANCOAL AUSTRALIA LTD
PAGE 10 OF 14

TABLE 7: BLAST MONITORING (GROUND VIBRATION)

				EPL Li	imits			Monitoring Poin	it	
Biast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-wha-ptg1	3/12/2018 12:25	mm/s		5	10	0.1	0.1	0.0	0.1	0.0
w34-wba-ps5	3/12/2018 13:51	mm/s		5	10	0.4	0.2	0.1	0.2	0.3
w27-wwe-k-co	4/12/2018 12:37	mm/s		5	10	0.1	0.1	0.1	0.1	0.1
w36-rcd-pr4	5/12/2018 11:32	mm/s		5	10	0.3	0.2	0.0	0.1	0.3
n45-rca-pr1	5/12/2018 12:48	mm/s		5	10	0.7	1.4	0.1	0.6	0.3
n32-wwa-ptg3	6/12/2018 14:41	mm/s	All Blasts 100%	5	10	0.1	0.1	0.0	0.1	0.0
w34-rcf-pr1	7/12/2018 9:25	mm/s		5	10	0.7	0.3	0.1	0.1	0.6
n37-wha-ptg2	11/12/2018 11:14	mm/s		5	10	0.0	0.0	0.0	0.1	0.0
w30-gmb-pr5	11/12/2018 13:17	mm/s		5	10	0.5	0.3	0.1	0.2	0.8
w38-wyc-pr4	13/12/2018 10:34	mm/s		5	10	0.5	0.5	0.1	0.4	0.8
l53-bla-md2	14/12/2018 9:42	mm/s		5	10	0.2	0.1	0.1	0.1	0.3

YANCOAL AUSTRALIA LTD
PAGE 11 OF 14

				EPL L	imits			Monitoring Poin	t	
Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
n37-wha-c-co3	14/12/2018 11:39	mm/s		5	10	0.0	0.0	0.0	0.1	0.0
n32-wwa-ptg4	15/12/2018 13:18	mm/s		5	10	0.1	0.2	0.0	0.1	0.1
n34-bfa-ps1	17/12/2018 13:08	mm/s		5	10	0.7	0.8	0.1	0.6	0.9
n41-wnd-ptg3	18/12/2018 11:35	mm/s		5	10	0.1	0.1	0.0	0.1	0.0
w28-wwe-ps3	19/12/2018 13:32	mm/s		5	10	0.0	0.0	0.0	0.4	0.0
w28-wwe-ps3 re-fire	19/12/2018 14:51	mm/s		5	10	0.8	0.5	0.1	0.7	0.7
n37-gmb-pr11 & n41- bla-ptg10	21/12/2018 13:14	mm/s		5	10	2.0	1.6	0.4	1.4	0.7
w28-wwe-ps4 & w28- wwe-md1	28/12/2018 12:02	mm/s		5	10	2.3	2.0	0.4	2.5	2.0
w38-wyc-pr5	28/12/2018 12:03	mm/s		5	10	0.9	0.6	0.1	0.3	1.0
n41-bla-ptg11	29/12/2018 11:12	mm/s		5	10	0.1	0.1	0.0	0.1	0.0
n32-bfb-ptg2	31/12/2018 12:37	mm/s		5	10	0.0	0.1	0.0	0.1	0.0
		,		Monthly	/ Meaningful	Data	'			'

YANCOAL AUSTRALIA LTD
PAGE 12 OF 14

Blast ID	Date and Time	Unit of Measure	Monitoring Frequency & Capture	EPL Limits		Monitoring Point				
				95% of Blasts	100% of Blasts	Bulga Village EPA ID # 6 (EPL 1376) & EPA ID # 7 (EPL 1976)	Wambo Road EPA ID # 5 (EPL 1376) & EPA ID # 6 (EPL 1976)	Putty Rd MTIE EPA ID # 8 (EPL 1376) & EPA ID # 9 (EPL 1976)	Warkworth EPA ID # 4 (EPL 1376) & EPA ID # 5 (EPL 1976)	Wollemi Peak Road EPA ID # 7 (EPL 1376) & EPA ID # 8 (EPL 1976)
Minimum	December	mm/s		5	10	0.02	0.03	0.02	0.07	0.01
Mean	December	mm/s		5	10	0.48	0.41	0.09	0.38	0.41
Maximum	December	mm/s		5	10	2.25	1.95	0.42	2.45	2.01
Median	December	mm/s		5	10	0.26	0.20	0.06	0.14	0.26

YANCOAL AUSTRALIA LTD
PAGE 13 OF 14

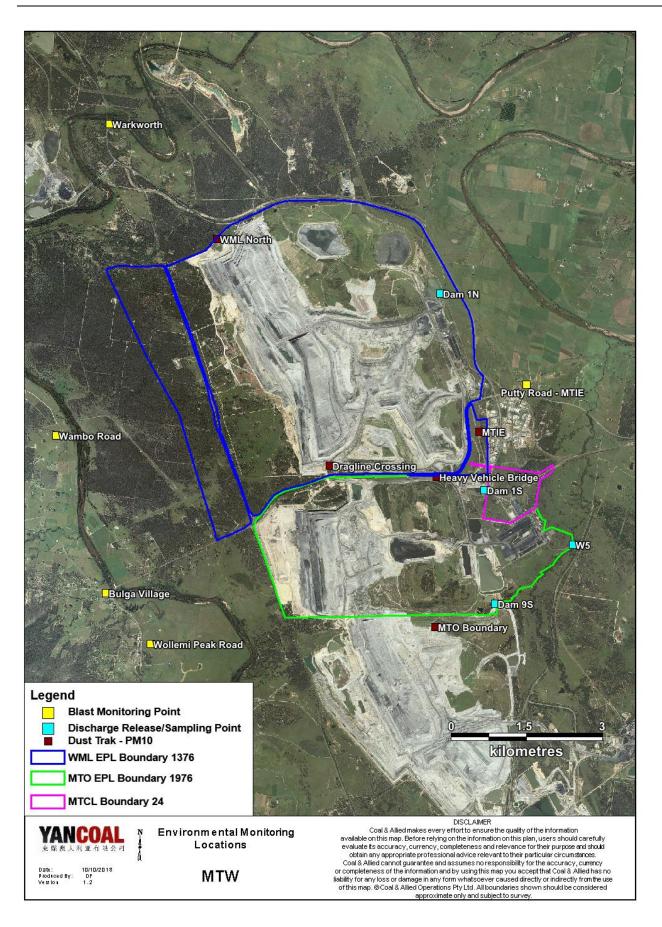


Figure 1: Mount Thorley Warkworth Environmental Monitoring Locations

YANCOAL AUSTRALIA LTD PAGE 14 OF 14